

## COLOSSOS XT Tooling Recommendation Guide



**Concrete Surface Preparation**  
 Determine Surface Hardness using MOHS Hardness Tester

**MOHS 7.5-9**

HARD SURFACE

**MOHS 4.5-7.5**

MEDIUM SURFACE

**MOHS 2-4.5**

SOFT SURFACE



Glue & Mastic


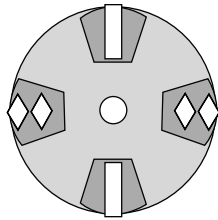


Plate Configuration

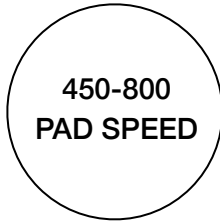

450-800  
PAD SPEED

Speed Range

HARD SURFACE	MEDIUM SURFACE	SOFT SURFACE
PNG 16 Grit HD 1 Segment 002-1415-00 QTY 16	PNG 16 Grit HD 1 Segment 002-1415-00 QTY 16	PNG 16 Grit HD 1 Segment 002-1418-00 QTY 16
PNG 16 Grit HD 2 Segment Shark 002-1426-00 QTY 16	PNG 16 Grit HD 2 Segment Shark 002-1426-00 QTY 16	PNG 16 Grit HD 2 Segment Shark 002-1427-00 QTY 16



Epoxy & Paint


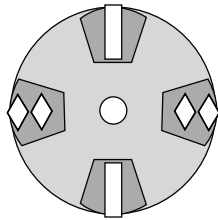


Plate Configuration

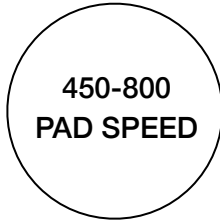

450-800  
PAD SPEED

Speed Range

PNG 16 Grit HD 1 Segment 002-1415-00 QTY 16	PNG 16 Grit HD 1 Segment 002-1415-00 QTY 16	PNG 16 Grit HD 1 Segment 002-1418-00 QTY 16
PNG 16 Grit HD 2 Segment Shark 002-1426-00 QTY 16	PNG 16 Grit HD 2 Segment Shark 002-1426-00 QTY 16	PNG 16 Grit HD 2 Segment Shark 002-1427-00 QTY 16



Thinset


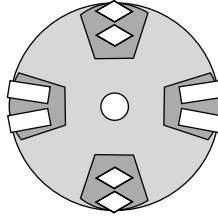



Plate Configuration

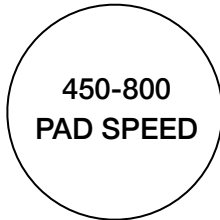

450-800  
PAD SPEED

Speed Range

PNG 16 Grit HD 2 Segment 002-1422-00 QTY 16	PNG 16 Grit HD 2 Segment 002-1422-00 QTY 16	PNG 16 Grit HD 2 Segment 002-1422-00 QTY 16
PNG 16 Grit HD 2 Segment Shark 002-1427-00 QTY 16	PNG 16 Grit HD 2 Segment Shark 002-1427-00 QTY 16	PNG 16 Grit HD 2 Segment Shark 002-1427-00 QTY 16

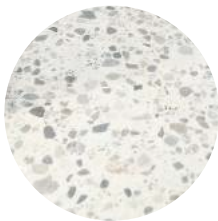

Exposed Aggregate


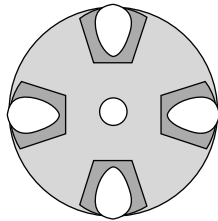



Plate Configuration

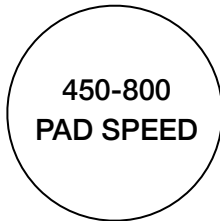

450-800  
PAD SPEED

Speed Range

PNG 16 Grit HD TearDrop 002-1481-00 QTY 32	PNG 16 Grit HD TearDrop 002-1499-00 QTY 32	PNG 16 Grit HD TearDrop 002-1505-00 QTY 32
---	---	---

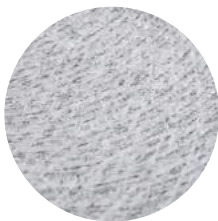

CSP 3 Profile


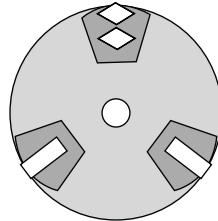


Plate Configuration

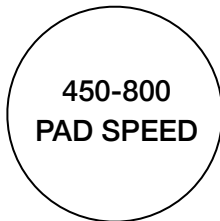

450-800  
PAD SPEED

Speed Range

PNG 16 Grit HD 1 Segment 002-1487-00 QTY 16	PNG 16 Grit HD 1 Segment 002-1415-00 QTY 16	PNG 16 Grit HD 1 Segment 002-1418-00 QTY 16
PNG 16 Grit HD 2 Segment Shark 002-1493-00 QTY 8	PNG 16 Grit HD 2 Segment Shark 002-1426-00 QTY 8	PNG 16 Grit HD 2 Segment Shark 002-1427-00 QTY 8



Cure 'n Seal


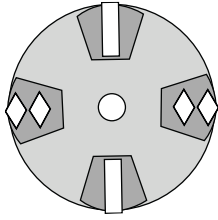


Plate Configuration

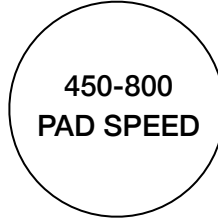

Speed Range

PNG 16 Grit HD 1 Segment 002-1415-00 QTY 16	PNG 16 Grit HD 1 Segment 002-1415-00 QTY 16	PNG 16 Grit HD 1 Segment 002-1418-00 QTY 16
PNG 16 Grit HD 2 Segment Shark 002-1426-00 QTY 16	PNG 16 Grit HD 2 Segment Shark 002-1426-00 QTY 16	PNG 16 Grit HD 2 Segment Shark 002-1427-00 QTY 16



Spalled Concrete


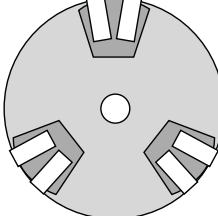


Plate Configuration

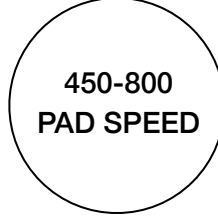

Speed Range

PNG 16 Grit HD 2 Segment Shark 002-1422-00 QTY 24	PNG 16 Grit HD 2 Segment Shark 002-1422-00 QTY 24	PNG 16 Grit HD 2 Segment Shark 002-1422-00 QTY 32
---	---	---



Vinyl Removal


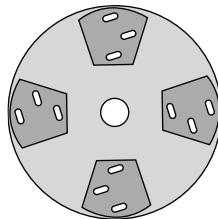


Plate Configuration

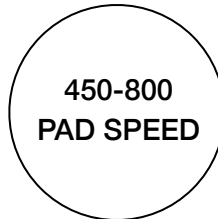

Speed Range

PNG TRI BIT PCD CW 002-1163-01 QTY 16	PNG TRI BIT PCD CW 002-1163-01 QTY 16	PNG TRI BIT PCD CW 002-1163-01 QTY 16
PNG TRI BIT PCD CCW 002-1164-01 QTY 16	PNG TRI BIT PCD CCW 002-1164-01 QTY 16	PNG TRI BIT PCD CCW 002-1164-01 QTY 16



Heavy Coatings


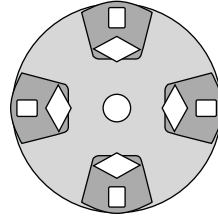


Plate Configuration\*

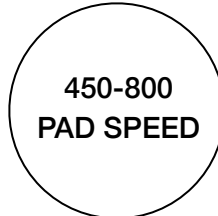


Speed Range

PNG PCD with TCD Shark CW 002-1350-00 QTY 16	PNG PCD with TCD Shark CW 002-1350-00 QTY 16	PNG PCD with TCD Shark CW 002-1350-00 QTY 16
PNG PCD with TCD Shark CCW 002-1349-00 QTY 16	PNG PCD with TCD Shark CCW 002-1349-00 QTY 16	PNG PCD with TCD Shark CCW 002-1349-00 QTY 16

\* Directional Tooling

Please see diagram below for rotation of PLUG 'N GO Plates. Tooling labelled CW or CCW must be placed on the correct plate in order to function effectively

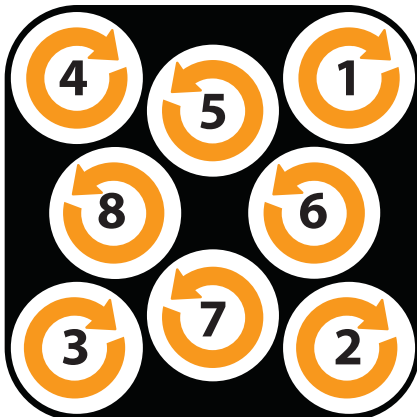

PLATES 1, 2, 3, 4 ROTATE CLOCKWISE



PLATES 5, 6, 7, 8 ROTATE COUNTER-CLOCKWISE

# WerkMaster Polished Concrete System Overview

## Step 1 - Metal Grinding - Prepare surface to achieve desired exposure


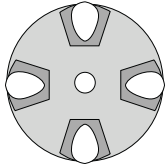


Plate Configuration

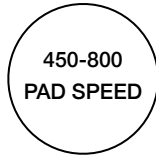

Speed Range

HARD	MEDIUM	SOFT
PNG 30/40 Grit HD TearDrop 002-1482-00 QTY 32	PNG 30/40 Grit HD TearDrop 002-1500-00 QTY 32	PNG 30/40 Grit HD TearDrop 002-1506-00 QTY 32
PNG 70/80 Grit HD TearDrop 002-1483-00 QTY 32	PNG 70/80 Grit HD TearDrop 002-1501-00 QTY 32	PNG 70/80 Grit HD TearDrop 002-1507-00 QTY 32

### GENERAL RULE:

Start with highest grit where possible and move to lower grit when necessary.

## Step 2 - Transition Stage - Remove metal tooling marks and prepares for densifying


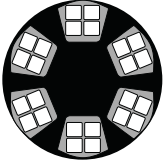


Plate Configuration

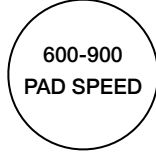

Speed Range

HARD	MEDIUM	SOFT
PNG Achromic 100 Grit 003-0247-00 QTY 48	PNG Achromic 100 Grit 003-0247-00 QTY 48	PNG Hybrid 100 Grit 003-0223-01 QTY 48

### INSTRUCTIONS:

Remove scratches using 100 Grit Achromic or Hybrid tooling. Transitional tooling effectively removes scratches and creates a surface ready for densifying.

## Step 3 - Densifying - Harden floor and prepare for polishing



Read label and follow directions

ULTRAhard Lithium 006-0132-00 - 5 Gallon
ULTRAhard Potassium 006-0129-00 - 5 Gallon
ULTRA densifil 006-0229-00 - 5 Gallon

### NOTE:

Ensure your floor has been vacuumed and all tool marks have been removed prior to densifying. *Densifiers also available in 1qt, 1gal, 2.5gal sizes.*

## Step 4 - Polishing - Bring floor to desired level of shine

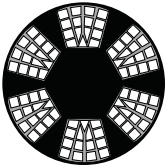


Plate Configuration



Speed Range

### Matte Finish

PNG PRO Resin - 200 Grit  
003-0236-00 QTY 48

### Semi-Gloss Finish

*Same as Matte Add:*

PNG PRO Resin - 400 Grit  
003-0237-00 QTY 48

PNG PRO Resin - 800 Grit  
003-0238-00 QTY 48

### High-Gloss Finish

*Same as Semi-Gloss Add:*

PNG PRO Resin - 1500 Grit  
003-0239-00 QTY 48

## Step 5 - Sealing - Protect and seal polished concrete surface



Read label and follow directions

ULTRAguard Sealer  
006-0130-00  
5 Gallon

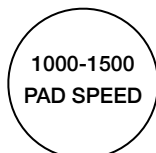
### NOTE:

Vacuum and clean floor prior to sealing. Apply 2 thin, light coats of sealer allowing cure time of 30 mins between coats. *Sealer also available in 1qt, 1gal, 2.5gal sizes.*

## Step 6 - Burnishing - Achieve maximum shine and polish



Buffing Pad



Speed Range

Pink Nylon - 8 inch Pad  
011-0046-00  
QTY 8

### OPTIONAL STAGE:

Burnish floor to achieve maximum shine and polish with either your WerkMaster Machine or Propane Burnisher.

# WerkMaster Polished Concrete Topping System Overview

## Step 1 - Metal Grinding - Prepare surface to achieve desired exposure


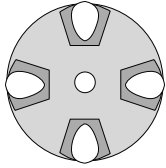


Plate Configuration

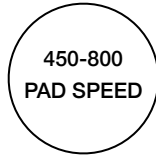

Speed Range

PNG 30/40 Grit  
HD TearDrop  
002-1500-00  
QTY 16

PNG 70/80 Grit  
HD TearDrop  
002-1501-00  
QTY 16

### INSTRUCTIONS:

Use a combination of two 30/40 Grit segment and two 70/80 Grit segments per tooling plate to remove polymer cream layer and expose aggregate.

## Step 2 - Transition Stage - Remove metal tooling marks and prepare for densifying

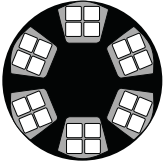


Plate Configuration



Speed Range

PNG Achromic  
100 Grit  
003-0247-00  
QTY 48

### INSTRUCTIONS:

Remove scratches using 100 Grit Achromic tooling. Achromic tooling effectively removes scratches and creates a surface ready for densification.

## Step 3 - Densifying - Harden floor and prepare for polishing



Read label and follow directions

ULTRAhard  
Lithium  
006-0132-00  
5 Gallon

### NOTE:

Ensure your floor has been vacuumed and all tool marks have been removed prior to densifying. *Densifiers also available in 1qt, 1gal, 2.5gal sizes.*

## Step 4 - Polishing - Bring floor to desired level of shine

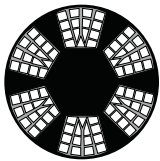


Plate Configuration



Speed Range

Matte Finish  
  
Semi-Gloss Finish  
  
High-Gloss Finish

PNG PRO Resin - 200 Grit 003-0236-00 QTY 48		
PNG Achromic - 200 Grit 003-0248-00 QTY 48	PNG PRO Resin - 400 Grit 003-0237-00 QTY 48	Diamond - 8 inch Pad 800 Grit 011-0064-00 QTY 8
PNG Achromic - 200 Grit 003-0248-00 QTY 48	PNG PRO Resin 400 -3000 Grit QTY 48	Diamond - 8 inch Pad 3000 Grit 011-0066-00 QTY 8

## Step 5 - Sealing - Protect and seal polished concrete surface



Read label and follow directions

ULTRAguard Sealer  
006-0130-00  
5 Gallon

### NOTE:

Vacuum and clean floor prior to sealing. Apply 2 thin, light coats of sealer allowing cure time of 30 mins in between coats. *Sealer also available in 1qt, 1gal, 2.5gal sizes.*

## Step 6 - Burnishing - Achieve maximum shine and polish



Buffing Pad



Speed Range

Pink Nylon - 8 inch Pad  
011-0046-00  
QTY 8

### OPTIONAL STAGE:

Burnish floor to achieve maximum shine and polish with either your WerkMaster Machine or Propane Burnisher.



# WerkMaster Cementitious Terrazzo Refinishing System Overview

## Step 1 - Light grind and prepare surface


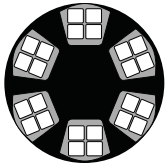


Plate Configuration

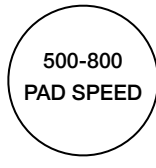

Speed Range

PNG 100 Grit  
HYBRID  
003-0223-01  
QTY 48

**INSTRUCTIONS:**

Remove contaminants and sealer. Evenly affect entire floor with hybrid tooling before moving to next step.

## Step 2 - Transition Stage - Remove hybrid tooling marks and prepare for densifying


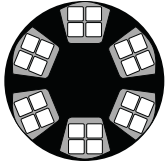


Plate Configuration

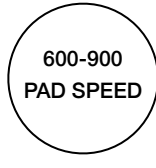

Speed Range

PNG Achromic  
200 Grit  
003-0248-00  
QTY 48

**INSTRUCTIONS:**

Remove scratches using 200 Grit Achromic tooling. Achromic tooling effectively removes scratches and creates a surface ready for densifying.

## Step 3 - Densifying - Harden floor and prepare for polishing



Read label and follow directions

ULTRAhard  
Lithium  
006-0132-00  
5 Gallon

**NOTE:**

Ensure your floor has been vacuumed and all tool marks have been removed prior to densifying. *Densifiers also available in 1qt, 1gal, 2.5gal sizes.*

## Step 4 - Polishing - Bring floor to desired level of shine

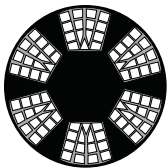


Plate Configuration



Speed Range

**Semi-Gloss Finish**

PNG PRO Resin - 400 Grit  
003-0237-00 QTY 48

---

PNG PRO Resin - 800 Grit  
003-0238-00 QTY 48

**High-Gloss Finish**

*Same as Semi-Gloss Add:*

PNG PRO Resin - 1500 Grit  
003-0239-00 QTY 48

## Step 5 - Sealing - Protect and seal polished terrazzo



Read label and follow directions

ULTRAGuard Sealer  
006-0130-00  
5 Gallon

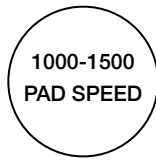
**NOTE:**

Vacuum and clean floor prior to sealing. Apply 2 thin, light coats of sealer allowing cure time of 30 mins between coats. *Sealer also available in 1qt, 1gal, 2.5gal sizes.*

## Step 6 - Burnishing - Achieve maximum shine and polish



Buffing Pad



Speed Range

Pink Nylon - 8 inch Pad  
011-0046-00  
QTY 8

**OPTIONAL STAGE:**

Burnish floor to achieve maximum shine and polish with either your WerkMaster Machine or Propane Burnisher.

# WerkMaster Epoxy Terrazzo Refinishing System Overview

## Step 1 - Light grind and prepare surface


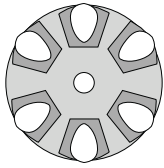


Plate Configuration

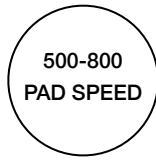

Speed Range

PNG 70/80 Grit  
HD TearDrop  
003-1501-00  
QTY 48

### INSTRUCTIONS:

Remove contaminants and sealer. Evenly affect entire floor with hybrid tooling before moving to next step.

## Step 2 - Polishing - Bring floor to desired level of shine

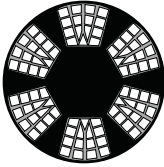


Plate Configuration



Speed Range

### Matte Finish

PNG Achromic - 100 Grit  
003-0247-00  
QTY 48

PNG PRO Resin - 200 Grit  
003-0236-00  
QTY 48

### Semi-Gloss Finish

*Same as Matte Add:*

PNG PRO Resin - 400 Grit  
003-0237-00 QTY 48

PNG PRO Resin - 800 Grit  
003-0238-00 QTY 48

### High-Gloss Finish

*Same as Semi-Gloss Add:*

PNG PRO Resin - 1500 Grit  
003-0239-00 QTY 48

## Step 3 - Sealing - Protect and seal your polished concrete surface



Read label and follow directions

ULTRAguard Sealer  
006-0130-00  
5 Gallon

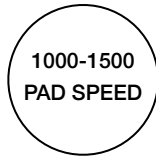
### NOTE:

Vacuum and clean floor prior to sealing. Apply 2 thin, light coats of sealer allowing cure time of 30 mins between coats. *Sealer also available in 1qt, 1gal, 2.5gal sizes.*

## Step 4 - Burnishing - Achieve maximum shine and polish



Buffing Pad



Speed Range












Pink Nylon - 8 inch Pad  
011-0046-00  
QTY 8

### OPTIONAL STAGE:





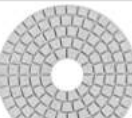

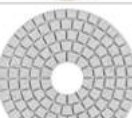
Burnish floor to achieve maximum shine and polish with either your WerkMaster Machine or Propane Burnisher.

# WerkMaster Tooling Legend



## PLUG 'N GO - Metal Bond Abrasives

IMAGE	DESCRIPTION
	Standard 1 Segment. Available in hard, medium or soft bond. Available in 16 - 30/40 - 70/80 grit.
	Heavy Duty 1 Segment. Available in hard, medium or soft bond. Available in 16 - 30/40 - 70/80 grit.
	Heavy Duty 2 Segment. Available in hard, medium or soft bond. Available in 16 - 30/40 - 70/80 grit.
	Standard 2 Segment Shark. Available in hard, medium or soft bond. Available in 16 - 30/40 - 70/80 grit.
	Heavy Duty 2 Segment Shark. Available in hard, medium or soft bond. Available in 16 - 30/40 - 70/80 grit.
	Standard TearDrop Segment. Available in hard, medium or soft bond. Available in 16 - 30/40 - 70/80 grit.
	TearDrop HD Segment. Available in hard, medium or soft bond. Available in 16 - 30/40 - 70/80 grit.
	PCD w/TCO Shark. Available in CW and CCW configuration.
	TRI-BIT PCD. Available in CW and CCW configuration.
	Full Plate Turbo Shark. Available in 3 and 5 inch diameter sizes.
	Vacuum Brazed Discs. Available in 30 and 70 grit. Available in 3 and 5 inch diameter sizes.

## PLUG 'N GO - Resin Bond Abrasives

IMAGE	DESCRIPTION
	Standard Dry Resin. Available in 100 - 3000 grit.
	Professional Resin. Available in 100 - 3000 grit.
	Achromic Resin. Available in 30 - 200 grit.
	Hybrid Resin. Available in 50 and 100 grit.
	Achromic Resin 3 inch Pad. Available in 50 grit.
	Granite and Marble Wet Resins 3 inch Pad. Available in 30 - 3000 grit.
	Countertop Quartz Pro Wet Resin. 3 inch Pad. Available in 30 - 3000 grit.
	Concrete Dry Resin. 3 inch Pad. Available in 100 - 3000 grit.

## PLUG 'N GO - Specialty Tooling

IMAGE	DESCRIPTION
	Half Segment - Super Segment. Available in 25 Grit.
	S-Segment Hardwood Refinishing & Aluminum Oxide removal.